

# HUNTER TRUCK

HUNTER JERSEY PETERBILT  
454 NORTH BROADWAY ST  
PENNSVILLE, NJ 08070  
P: (856) 299-5010  
F: (856) 299-5020

BILL TO  
JIM COMLY - 36296  
PENNSVILLE NJ 08070

DELIVER TO  
JIM COMLY - 36296  
PENNSVILLE NJ 08070  
P: 000-0000

## SERVICE ESTIMATE: E206000208

DATE ARRIVED	DATE INVOICE	SALES TYPE	ADVISOR	TERMS	CUSTOMER REFERENCE			
04/10/2019 7:29:55AM		SRET	R MCGINNIS	CASH	EST			
YEAR	MAKE	MODEL	VIN	CUSTOMER UNIT #	ENGINE HOURS	IN SERVICE	Component Serial #	ODOMETER
2015	PETERBILT	365	1NPSLH0X5FD205027	1	10,450	1/1/1999	75027292	358319

### JOB #1 45-000 ENGINE - SYSTEM

COMPLAINT ENGINE - SYSTEM  
DURING INSPECTIONS, FOUND CHECK ENGINE LIGHT ON

CAUSE CHECK ENGINE LIGHT

CORRECTION DURING INSPECTIONS, FOUND CHECK ENGINE LIGHT ACTIVE FOR MULTIPLE CYLINDER MISFIRE. COMMON FAILURES COULD BE SPARK PLUGS, WIRING, IGNITION COILS OR IGNITION CONTROL MODULE. ENGINE RUNS VERY ROUGH. WILL NEED TO PERFORM CYLINDER LEAK DOWN TESTS, IGNITION CIRCUIT TESTS, INSPECT COILS AND PLUGS. AS LONG AS IGNITION AND CYLINDER COMPONENTS PASS TESTING, WILL NEED TO REPLACE THE SPARK PLUGS, THEN PERFORM ROADTEST TO VERIFY NO FURTHER ISSUES PRESENT.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC2	ASSIGNED MAINTENANCE COST 2	10.50	10.50
6	206C/4309391	KIT, SPARK PLUG	45.83	274.98
	LABOR 45-000-09	ENGINE - SYSTEM - TROUBLESHOOT		472.50

Parts: \$274.98 Labor: \$472.50 Misc: \$10.50 Sublet: \$0 \$757.98

### JOB #2 32-000 CRANKING - SYSTEM

# ESTIMATE

COMPLAINT CRANKING - SYSTEM  
DURING WALK AROUND FOUND BATTERIES WOULD NOT CHARGE

CAUSE BATTERIES

CORRECTION DURING WALK AROUND FOUND UNIT WOULD NOT START, JUMP STARTED TRUCK, BATTERIES WOULD NOT HOLD CHARGE, WILL NEED TO REMOVE AND REPLACE BATTERIES

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
-4	AMC	CORE	33.75	-135.00
4	206P/BT31S91EXCH	(DEK) BATTERY-HD GRP 31 TERM*D	83.00	332.00
4	206P/BT31S91EXCH-CORE	BATTERY-HD GRP 31 TERM STUD *D	33.75	135.00
	LABOR 32-000-03	CRANKING - CRANKING - REPLACE		187.50

Parts: \$467.00 Labor: \$187.50 Misc: \$(129.50) Sublet: \$0 \$525.00

# HUNTER TRUCK

SERVICE ESTIMATE: E206000208

## JOB #3 13-000 BRAKES - AIR SYSTEM

COMPLAINT BRAKES - AIR SYSTEM  
DURING WALK AROUND FOUND ABS LIGHT ON.

CAUSE ABS LIGHT ON

CORRECTION DURING WALK AROUND FOUND ABS LIGHT ACTIVE. COULD NOT CONNECT TO ABS MODULE. CHECKED FUSES AND FOUND NO OBVIOUS SIGNS OF ISSUES. WILL NEED T/S CAN WIRING TO BENDIX MODULE, CONNECT TO BENDIX, PULL CODES AND T/S AS NEEDED.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
	LABOR 13-000-09	BRAKES - AIR SYSTEM - TROUBLESHOOT		125.00

Parts: \$0 Labor: \$125.00 Misc: \$5.50 Sublet: \$0 \$130.50

## JOB #4 02-000 CAB - SYSTEM

COMPLAINT CAB - SYSTEM  
DURING WALK AROUND FOUND BOTH WINDSHIELDS DAMAGED.

CAUSE WINDSHIELDS

CORRECTION DURING WALK AROUND FOUND WINDSHIELDS TO BE DAMAGED. WILL NEED TO REMOVE AND REPLACE BOTH WINDSHIELDS.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 02-000-03	CAB - SYSTEM - REPLACE		218.86
1	206P/20-14898-20L	GLASS-WINDSHIELD ENCAPSULATED	110.57	110.57
1	206P/20-14898-20R	GLASS-WINDSHIELD ENCAPSULATED	110.57	110.57
1	206P/28-00236-0000	SEAL - BUTYL 27 FT ROLL	5.13	5.13

Parts: \$226.27 Labor: \$218.86 Misc: \$0 Sublet: \$0 \$445.13

## JOB #5 45-000 ENGINE - SYSTEM

COMPLAINT ENGINE - SYSTEM  
DURING WALK AROUND FOUND ENGINE OIL LEAK

CAUSE OIL LEAK

CORRECTION DURING WALK AROUND FOUND OIL LEAK AT ENGINE. WILL NEED TO STEAM ENGINE, RUN ENGINE AND VISUALLY INSPECT ENGINE FOR OIL LEAKS. ONCE OIL LEAKS ARE IDENTIFIED WILL NEED TO REPAIR AS NEEDED.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	206P/EB1RSS	(RS) CLEANER-ENGINE BRITE 16*D	5.42	5.42
	LABOR 45-000-09	ENGINE - SYSTEM - TROUBLESHOOT		135.00

Parts: \$5.42 Labor: \$135.00 Misc: \$0 Sublet: \$0 \$140.42

## JOB #6 02-000 CAB - SYSTEM

COMPLAINT CAB - SYSTEM  
DURING WALK AROUND FOUND 1/4 FENDER AND LIGHTS MISSING

CAUSE QUARTER FENDERS AND LIGHTS MISSING

CORRECTION DURING WALK AROUND FOUND 1/4 FENDER AND LIGHTS MISSING. WILL NEED TO INSTALL FENDERS AND LIGHTS. THEN WILL NEED TO SPLICE LIGHTS AND VERIFY PROPER OPERATION.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 02-000-24	CAB - SYSTEM - REPAIR		250.00
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
2	206P/L33-6019	SKIRT-FENDER 365/367 SFFA LH	271.65	543.30
2	206X/J25466	SIDE MKR LAMP KIT P54-6008-111	47.50	95.00

Parts: \$638.30 Labor: \$250.00 Misc: \$5.50 Sublet: \$0 \$893.80

# HUNTER TRUCK

SERVICE ESTIMATE: E206000208

## JOB #7 02-000 CAB - SYSTEM

COMPLAINT CAB - SYSTEM  
DURING WALK AROUND FOUND HOOD CRACKED

CAUSE HOOD DAMAGED

CORRECTION DURING WALK AROUND FOUND HOOD TO BE DAMAGED. WILL NEED TO SEND NEW HOOD FOR PAINT. ONCE HOOD RETURNS WILL NEED TO REMOVE/REPLACE HOOD AND ALIGN.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 02-000-03	CAB – SYSTEM - REPLACE		375.00
1	AMC2	ASSIGNED MAINTENANCE COST 2	10.50	10.50
1	AMC	PAINT	2,000.00	2,000.00
1	206P/L29-6073-1200020	HOOD-365 SF NON-PRIMED TILT W/	7,206.15	7,206.15

Parts: \$7,206.15 Labor: \$375.00 Misc: \$2,010.50 Sublet: \$0 \$9,591.65

## JOB #8 34-000 LIGHTING - SYSTEM

COMPLAINT LIGHTING - SYSTEM  
DURING WALK AROUND FOUND LEFT HEAD LAMP INOP

CAUSE HEAD LAMP

CORRECTION DURING WALK AROUND FOUND HEAD LAMP INOP. WOULD NEED TO CHECK FOR CORRECT VOLTAGE AND REPLACE LIGHT AS NEEDED.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
1	206P/9003LLBULB	BULB-HEADLAMP SEALED HEADLI	25.47	25.47
	LABOR 34-000-09	LIGHTING – SYSTEM - TROUBLESHOOT		125.00

Parts: \$25.47 Labor: \$125.00 Misc: \$5.50 Sublet: \$0 \$155.97

## JOB #9 44-000 FUEL - SYSTEM

COMPLAINT FUEL - SYSTEM  
DURING WALK AROUND FOUND FUEL TANK COVER DAMAGED

CAUSE FUEL TANK COVER

CORRECTION DURING WALK AROUND FOUND FUEL TANK COVER DAMAGED. RECOMMEND REPLACEMENT. WOULD HAVE TO CONTACT BODY COMPANY FOR PARTS PRICING DUE TO NOT BEING A PETERBILT SUPPLIED PART. CAN REPLACE ONCE PART IS PURCHASED.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
	LABOR 44-000-03	FUEL – SYSTEM - REPLACE		187.50

Parts: \$0 Labor: \$187.50 Misc: \$5.50 Sublet: \$0 \$193.00

## JOB #10 17-000 TIRES - SYSTEM

COMPLAINT TIRES - SYSTEM  
DURING WALK AROUND FOUND TIRES LOW ON FOWARD REAR AXLE

CAUSE TIRES WORN

CORRECTION DURING WALK AROUND FOUND STEER TIRES WORN. WILL NEED TO LUIFT UNIT, REMOVED WHEELS, REMOVED AND REPLACE TIRES. INSTALL WHEELS AND TORQUE LUG WHEELS TO SPEC

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC2	ASSIGNED MAINTENANCE COST 2	10.50	10.50
4	AMC	DRIVE AXLE TIRE (GT GAM835) 11R24.5	574.00	2,296.00
	LABOR 17-000-03	TIRES – SYSTEM - REPLACE		312.50

Parts: \$0 Labor: \$312.50 Misc: \$2,306.50 Sublet: \$0 \$2,619.00

# HUNTER TRUCK

SERVICE ESTIMATE: E206000208

## JOB #11 34-000 LIGHTING - SYSTEM

COMPLAINT LIGHTING - SYSTEM  
DURING WALK AROUND FOUND CENTER BRAKE INOP.

CAUSE BRAKE LIGHT INOP

CORRECTION DURING WALK AROUND FOUND BRAKE LIGHT INOP. WILL NEED TO CHECK FOR CORRECT VOLTAGE. IF CORRECT VOLTAGE IS FOUND WOULD NEED TO REPLACE BRAKE LIGHT.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
1	206P/44030R	KIT-LIGHT LED S/T/T 6DIO W/ *D	26.46	26.46
	LABOR 34-000-09	LIGHTING - SYSTEM - TROUBLESHOOT		37.50

Parts: \$26.46 Labor: \$37.50 Misc: \$5.50 Sublet: \$0 \$69.46

## JOB #12 34-000 LIGHTING - SYSTEM

COMPLAINT LIGHTING - SYSTEM  
DURING WALK AROUND FOUND LIGHT ON BODY OUT.

CAUSE BODY LIGHT INOP

CORRECTION DURING WALK AROUND FOUND BODY LIGHT INOP. WILL NEED TO CHECK FOR CORRECT VOLTAGE. IF CORRECT VOLTAGE IS FOUND WOULD NEED TO REPLACE BODY LIGHT.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
1	206P/LB045201	LAMP - MARKER 2 INCH ROUND AMB	1.28	1.28
	LABOR 34-000-09	LIGHTING - SYSTEM - TROUBLESHOOT		37.50

Parts: \$1.28 Labor: \$37.50 Misc: \$5.50 Sublet: \$0 \$44.28

## JOB #13 02-000 CAB - SYSTEM

COMPLAINT CAB - SYSTEM  
DURING WALK AROUND FOUND MUDFLAP TORN

CAUSE MUDFLAP

CORRECTION DURING WALK AROUND FOUND MUDFLAP TORN. WILL NEED TO REMOVED AND REPLACE MUDFLAP.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 02-000-03	CAB - SYSTEM - REPLACE		37.50
1	206X/24X36X1/2	COW MAT FLAP 1/2" THICK-EACH	48.85	48.85

Parts: \$48.85 Labor: \$37.50 Misc: \$0 Sublet: \$0 \$86.35

## JOB #14 13-000 BRAKES - AIR SYSTEM

COMPLAINT BRAKES - AIR SYSTEM  
DURING WALK AROUND FOUND BRAKE PEDAL STICKING

CAUSE BRAKE PEDAL STICKING

CORRECTION DURING WALK AROUND FOUND BRAKE PEDAL STICKING. WILL NEED TO REMOVED SEIZED PINS. CLEAN COMPONETS. INSTALL NEW PIN AND VERIFY PROPER OPERATION.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
	LABOR 13-000-09	BRAKES - AIR SYSTEM - TROUBLESHOOT		250.00
1	206P/235212BXW	PIN-ROLL *D	1.46	1.46
1	206P/238888BXW	PIN-IDLER *D	9.06	9.06
1	206X/BLP16-PB	PENETRANT BLASTER	7.85	7.85

Parts: \$18.37 Labor: \$250.00 Misc: \$5.50 Sublet: \$0 \$273.87

# HUNTER TRUCK

SERVICE ESTIMATE: E206000208

## JOB #15 13-000 BRAKES - AIR SYSTEM

COMPLAINT BRAKES - AIR SYSTEM  
 DURING WALK AROUND FOUND REAR AXLE BRAKES LOW

CAUSE REAR AXLE BRAKES LOW

CORRECTION DURING WALK AROUND FOUND REAR AXLE BRAKES LOW. WILL NEED LIFT UNIT, REMOVED TIRES. THEN WILL NEED TO REMOVE AND REPLACE BRAKE PADS, CLEAN COMPONENTS, ADJUST BRAKES AND INSTALL TIRES. ONCE COMPONENTS ARE INSTALLED WILL NEED TO VERIFY PROPER OPERATION.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
	LABOR 13-000-09	BRAKES – AIR SYSTEM - TROUBLESHOOT		250.00
1	206P/K070796BXW	KIT-DISC PAD, STD ADB22X, 1 *D	198.35	198.35

Parts: \$198.35 Labor: \$250.00 Misc: \$5.50 Sublet: \$0 \$453.85

# ESTIMATE

### TERMS OF SALE

- All sales are cash, unless other arrangements have been made. If charging, all amounts are due and payable net ten prox (Due by the 10th of the month following billing). No discounts permitted.
- All past due amounts are subject to a service charge of 1 ½ % per month (18% per annum) on all past due balances.
- No returns on electrical. No returns on special order items or items not returnable to the manufacturer. A restocking charge of 15% will apply on all other returns. Returns must be made within 30 days to receive credit.
- Cores must be returned within 30 days to receive credit.
- The seller hereby certifies that these goods were produced in compliance with all applicable requirements of sections 6, 7 and 12 of the Fair Labor Standards Act of 1938, as amended and of the regulations and orders of the administrator or wage and hour division issues under section 14 thereof.
- By providing sales tax exemption number, customer certifies he is exempt from any sales or occupation tax and agrees if he is ruled to be not exempt by taxing authorities he will be responsible for any tax assessment made by the state of PA or another taxing authority and agrees to reimburse seller for any amount now due or becoming due, including penalties and interest, if assessed. In addition, buyer agrees to pay costs of pat due collection, including reasonable attorney's fees.
- NO REFUND WITHOUT THIS NOTICE

### WARRANTY

ANY WARRANTIES ON THE PRODUCTS SOLD ARE AVAILABLE ONLY FROM THE MANUFACTURER OR REBUILDER OF SAID PRODUCTS. THE SELLER AGREES TO PASS TO CUSTOMER ANY AVAILABLE WARRANTIES. THE SELLER MAKES NO WARRANTIES OF ANY PRODUCTS SOLD AND AUTHORIZES NO PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF THE PRODUCTS SHOW. THE SELLER IS NOT RESPONSIBLE FOR LABOR ON PARTS NOT INSTALLED BY OUR SHOP.

LABOR	\$3,001.36
PARTS	\$9,136.90
MISC	\$4,242.00
SUBLET	\$0.00
<b>SUBTOTAL</b>	<b>\$16,380.26</b>
SHOP SUPPLIES	\$0.00
MISC SUPPLIES	\$0.00
TAX	\$1,085.19
<b>TOTAL</b>	<b>\$17,465.45</b>

Please Remit Payment to:  
 HUNTER JERSEY PETERBILT  
 PO BOX 820849  
 PHILADELPHIA, PA 19182-0849

AUTHORIZED BY \_\_\_\_\_ DATE \_\_\_\_\_