

# HUNTER TRUCK

HUNTER JERSEY PETERBILT  
454 NORTH BROADWAY ST  
PENNSVILLE, NJ 08070  
P: (856) 299-5010  
F: (856) 299-5020

BILL TO  
JIM COMLY - 36296  
PENNSVILLE NJ 08070

DELIVER TO  
JIM COMLY - 36296  
PENNSVILLE NJ 08070  
P: 000-0000

## SERVICE ESTIMATE: E206000205

DATE ARRIVED	DATE INVOICE	SALES TYPE	ADVISOR	TERMS	CUSTOMER REFERENCE
04/10/2019 7:28:28AM		SRET	R MCGINNIS	CASH	EST

YEAR	MAKE	MODEL	VIN	CUSTOMER UNIT #	ENGINE HOURS	IN SERVICE	Component Serial #	ODOMETER
2015	PETERBILT	CONVENTIONAL	1NPSLH0X9FD205032	6	1,609		75027296	370850

### JOB #1 32-000 CRANKING - SYSTEM

COMPLAINT CRANKING - SYSTEM  
DURING INSPECTIONS, FOUND BATTERIES NEED REPLACED

CAUSE BATTERIES

CORRECTION ATTEMPTED TO START TRUCK. TRUCKS COMPLETELY DEAD. JUMP STARTED TRUCK AND GET RUNNING. RAN ENGINE TO CHARGE BATTERIES BUT BATTERIES WILL NOT HOLD A CHARGE. PERFORMED BATTERY TEST TO FIND BATTERIES FAILED. UNIT WILL NEED BATTERIES.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
3	206P/YEL31STUD	(OPT) BATTERY-YELLOW TOP D31*D	431.44	1,294.32
	LABOR 32-000-09	CRANKING - CRANKING - TROUBLESHOOT		125.00

Parts: \$1,294.32 Labor: \$125.00 Misc: \$5.50 Sublet: \$0 \$1,424.82

### JOB #2 02-000 CAB - SYSTEM

COMPLAINT CAB - SYSTEM  
DURING INSPECTIONS, FOUND FRONT BUMPER DAMAGED

CAUSE BUMPER

CORRECTION TOOK PHOTOS OF BUMPER DAMAGE. RECOMMEND BUMPER REPLACEMENT.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 02-000-09	CAB - SYSTEM - TROUBLESHOOT		125.00
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
1	206P/TU08V0010-02NS	PB 10GA CHRМ, 16" TAPER *D	413.58	413.58

Parts: \$413.58 Labor: \$125.00 Misc: \$5.50 Sublet: \$0 \$544.08

# HUNTER TRUCK

SERVICE ESTIMATE: E206000205

## JOB #3 02-000 CAB - SYSTEM

COMPLAINT CAB - SYSTEM  
DURING VEHICLE INSPECTIONS, FOUND RIGHT SIDE STEP MISSING

CAUSE STEP

CORRECTION DURING INSPECTIONS, FOUND RIGHT SIDE STEP MISSING. TOOK PHOTOS, RECOMMEND REPLACEMENT OF MISSING STEP.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 02-000-09	CAB - SYSTEM - TROUBLESHOOT		62.50
1	206P/11-03942-0750	STEP-FUEL TANK ALUM 750MM	223.16	223.16

Parts: \$223.16 Labor: \$62.50 Misc: \$0 Sublet: \$0 \$285.66

## JOB #4 52-000 ELECTRICAL ACCESSORIES

COMPLAINT ELECTRICAL ACCESSORIES  
DURING INSPECTIONS, FOUND FOG LIGHTS INOP

CAUSE ELECTRICAL

CORRECTION DURING INSPECTIONS, FOUND BOTH FOG LIGHTS INOP/ CHECKED FUSES TO VERIFY NO ISSUES PRESENT. FOG LIGHT OPERATION COULD BE DUE TO WIRING OR LIGHT BULB FAILURE, LENSES ARE DAMAGED FOR FOG LAMPS, SO WATER INTRUSION COULD HAVE CAUSED BULB FAILURE. RECOMMEND REPLACEMENT OF FOG LAMPS AND VERIFY WIRING TO LIGHTS ARE CORRECT.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
2	206P/16-09790-001	LIGHT-FOG RECTANGULAR W/H9415	192.87	385.74
	LABOR 52-000-09	ELECTRICAL ACCESSORIES - TROUBLESHOOT		187.50

Parts: \$385.74 Labor: \$187.50 Misc: \$5.50 Sublet: \$0 \$578.74

## JOB #5 02-000 CAB - SYSTEM

COMPLAINT CAB - SYSTEM  
DURING VEHICLE INSPECTIONS, FOUND RIGHT SIDE WINDSHIELD CRACKED

CAUSE WINDSHIELD

CORRECTION DURING INSPECTIONS, FOUND RIGHT SIDE WINDSHIELD CRACKED. TOOK PHOTOS. RECOMMEND REPLACEMENT.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
1	206P/20-14898-20R	GLASS-WINDSHIELD ENCAPSULATED	110.57	110.57
1	206P/28-00236-0000	SEAL - BUTYL 27 FT ROLL	5.13	5.13
	LABOR HT-022	REPLACE ONE WINDSHIELD (TWO PIECE)		187.50

Parts: \$115.70 Labor: \$187.50 Misc: \$5.50 Sublet: \$0 \$308.70

# HUNTER TRUCK

SERVICE ESTIMATE: E206000205

## JOB #6 13-000 BRAKES - AIR SYSTEM

COMPLAINT BRAKES - AIR SYSTEM  
DURING INSPECTIONS, FOUND ABS LIGHT ACTIVE

CAUSE WHEEL SPEED SENSOR FAULTS

CORRECTION DURING VEHICLE INSPECTIONS, FOUND DRIVE AXLE LEFT WHEEL SPEED SENSOR FAULTS PRESENT. PERFORMED VISUAL INSPECTION ON SENSOR, NO OBVIOUS SIGNS OF DAMAGE PRESENT. FAILURES COULD INCLUDE A SENSOR, ABS WIRING HARNESS, OR MODULE. WILL NEED TO CHECK THE WIRING TO THE SENSOR AND PERFORM A RESISTANCE CHECK ON THE SENSOR, IF THE SENSOR RESISTANCE IS OUT OF SPEC, WILL REPLACE THE SENSOR, THEN PERFORM A ROADTEST TO VERIFY NO FAULTS RETURN.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC2	ASSIGNED MAINTENANCE COST 2	10.50	10.50
	LABOR 13-000-09	BRAKES - AIR SYSTEM - TROUBLESHOOT		250.00
1	206P/K051959BXW	SENSOR-WHEEL SPEED *D	62.21	62.21

Parts: \$62.21 Labor: \$250.00 Misc: \$10.50 Sublet: \$0 \$322.71

## JOB #7 45-000 ENGINE - SYSTEM

# ESTIMATE

COMPLAINT ENGINE - SYSTEM  
DURING VEHICLE INSPECTION, FOUND CHECK ENGINE LIGHT ACTIVE

CAUSE ENGINE MISFIRE FAULTS

CORRECTION PULLED ENGINE FAULTS, FOUND MULTIPLE FAULTS FOR ENGINE MISFIRE. COMMON FAILURES COULD BE SPARK PLUGS, WIRING, IGNITION COILS OR IGNITION CONTROL MODULE. ENGINE RUNS VERY ROUGH. WILL NEED TO PERFORM CYLINDER LEAK DOWN TESTS, IGNITION CIRCUIT TESTS, INSPECT COILS AND PLUGS. AS LONG AS IGNITION AND CYLINDER COMPONENTS PASS TESTING, WILL NEED TO REPLACE THE SPARK PLUGS, THEN PERFORM ROADTEST TO VERIFY NO FURTHER ISSUES PRESENT.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC2	ASSIGNED MAINTENANCE COST 2	10.50	10.50
6	206C/4309391	KIT,SPARK PLUG	45.83	274.98
	LABOR 45-000-09	ENGINE - SYSTEM - TROUBLESHOOT		472.50

Parts: \$274.98 Labor: \$472.50 Misc: \$10.50 Sublet: \$0 \$757.98

## JOB #8 45-000 ENGINE - SYSTEM

COMPLAINT ENGINE - SYSTEM  
DURING VEHICLE INSPECTIONS, FOUND OIL PAN GASKET LEAKS OIL

CAUSE OIL PAN GASKET

CORRECTION DURING INSPECTIONS, FOUND OIL PAN GASKET LEAKING OIL. WOULD NEED TO STEAM CLEAN ENGINE, REMOVE OIL PAN, REPLACE GASKET AND REINSTALL PAN. WILL NEED TO THEN FILL OIL AND RUN ENGINE TO VERIFY NO FURTHER LEAKS PRESENT.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
3	206C/875572	NAT GAS PAIL 15W40	76.66	229.98
1	206P/4975069CUM	GASKET-OIL PAN	162.78	162.78
1	206P/LF14000NNFLG	(FL) FILTER *D	38.93	38.93
	LABOR 45-000-09	ENGINE - SYSTEM - TROUBLESHOOT		270.00

Parts: \$431.69 Labor: \$270.00 Misc: \$5.50 Sublet: \$0 \$707.19

# HUNTER TRUCK

SERVICE ESTIMATE: E206000205

## JOB #9 02-000 CAB - SYSTEM

COMPLAINT CAB - SYSTEM  
 DURING VEHICLE INSPECTIONS, FOUND BOTH FRONT QUARTER FENDERS ARE CRACKED

CAUSE QUARTER FENDERS

CORRECTION DURING INSPECTIONS, FOUND BOTH QUARTER FENDERS ARE CRACKED AND MARKER LAMPS ARE NOT OPERATIONAL. QUARTER FENDERS SHOULD BE REPLACED AND BOTH LAMPS SHOULD BE INSPECTED FURTHER. COMMON FAILURE FOR THESE LAMPS WOULD BE WATER INTRUSION INTO THE PLUG CAUSING PLUG FAILURE. WOULD NEED TO REPLACE QUARTER FENDERS, INSPECT WIRING AND PLUG FOR LAMPS AND REPLACE PLUGS/BULBS. FOLLOWING REPLACEMENT WILL VERIFY PROPER OPERATION.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 02-000-09	CAB – SYSTEM - TROUBLESHOOT		375.00
1	AMC2	ASSIGNED MAINTENANCE COST 2	10.50	10.50
1	206P/L33-6027	SKIRT-FENDER,365 SFFA	273.70	273.70
1	206P/L33-6027R	SKIRT-FENDER,365 SFFA	273.70	273.70
1	206P/L92-6033-0100	HARNESS-WIRE-JUMPER	39.88	39.88
1	206P/L92-6041-0100	HARNESS-LH MARKER	40.09	40.09
2	206P/P54-6169	LAMP-MARKER/TURN INDICATOR LED	55.37	110.74

Parts: \$738.11 Labor: \$375.00 Misc: \$10.50 Sublet: \$0 \$1,123.61

## JOB #10 34-000 LIGHTING - SYSTEM

COMPLAINT LIGHTING - SYSTEM  
 DURING VEHICLE INSPECTIONS, FOUND MULTIPLE BODY LAMPS INOP

CAUSE LED LAMPS

CORRECTION DURING INSPECTIONS, FOUND TWO 2" AMBER LED LAMPS INOP AND ONE 2" RED LED LAMP INOP ON THE BODY. RECOMMEND REPLACEMENT OF LAMPS FOLLOWING VERIFICATION OF POWER AND GROUND TO THE LAMPS, THEN VERIFY PROPER OPERATION.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
2	206P/LL045801	LAMP-LED MRKR 2.5" AMBR,	6.67	13.34
2	206P/LL045902	LAMP-LED MRKR 2.5" RED, 1	6.67	13.34
	LABOR 34-000-09	LIGHTING – SYSTEM - TROUBLESHOOT		125.00

Parts: \$26.68 Labor: \$125.00 Misc: \$5.50 Sublet: \$0 \$157.18

### TERMS OF SALE

- All sales are cash, unless other arrangements have been made. If charging, all amounts are due and payable net ten prox (Due by the 10th of the month following billing). No discounts permitted.
- All past due amounts are subject to a service charge of 1 ½ % per month (18% per annum) on all past due balances.
- No returns on electrical. No returns on special order items or items not returnable to the manufacturer. A restocking charge of 15% will apply on all other returns. Returns must be made within 30 days to receive credit.
- Cores must be returned within 30 days to receive credit.
- The seller hereby certifies that these goods were produced in compliance with all applicable requirements of sections 6, 7 and 12 of the Fair Labor Standards Act of 1938, as amended and of the regulations and orders of the administrator or wage and hour division issues under section 14 thereof.
- By providing sales tax exemption number, customer certifies he is exempt from any sales or occupation tax and agrees if he is ruled to be not exempt by taxing authorities he will be responsible for any tax assessment made by the state of PA or another taxing authority and agrees to reimburse seller for any amount now due or becoming due, including penalties and interest, if assessed. In addition, buyer agrees to pay costs of pat due collection, including reasonable attorney's fees.
- NO REFUND WITHOUT THIS NOTICE

### WARRANTY

ANY WARRANTIES ON THE PRODUCTS SOLD ARE AVAILABLE ONLY FROM THE MANUFACTURER OR REBUILDER OF SAID PRODUCTS. THE SELLER AGREES TO PASS TO CUSTOMER ANY AVAILABLE WARRANTIES. THE SELLER MAKES NO WARRANTIES OF ANY PRODUCTS SOLD AND AUTHORIZES NO PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF THE PRODUCTS SHOW. THE SELLER IS NOT RESPONSIBLE FOR LABOR ON PARTS NOT INSTALLED BY OUR SHOP.

LABOR	\$2,180.00
PARTS	\$3,966.17
MISC	\$64.50
SUBLET	\$0.00
<b>SUBTOTAL</b>	<b>\$6,210.67</b>
SHOP SUPPLIES	\$0.00
MISC SUPPLIES	\$0.00
TAX	\$411.46
<b>TOTAL</b>	<b>\$6,622.13</b>

Please Remit Payment to:

HUNTER JERSEY PETERBILT  
 PO BOX 820849  
 PHILADELPHIA, PA 19182-0849

AUTHORIZED BY \_\_\_\_\_ DATE \_\_\_\_\_